

ifm electronic




Operating instructions
Pressure sensor

efector500[®]

PN30xx

UK

704882 / 00 08 / 2010

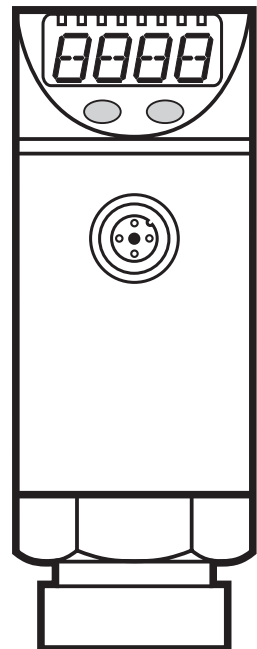

Contents

1	Preliminary note.....	3
1.1	Symbols used	3
2	Safety instructions	3
3	Functions and features	4
4	Function.....	5
4.1	Processing of the measured signals.....	5
4.2	Switching function.....	5
4.3	Analogue function	6
5	Installation.....	6
6	Electrical connection.....	6
7	Operating and display elements	7
8	Menu.....	8
8.1	Menu structure	8
8.2	Explanation of the menu	9
9	Parameter setting	10
9.1	Parameter setting general	10
9.2	Configuring the display (optional).....	12
9.3	Configuration of output 1	12
9.3.1	Setting the output function	12
9.3.2	Setting the switching limits	12
9.4	Configuration of output 2	12
9.5	User settings (optional).....	12
9.5.1	Setting the delay time for OUT1	12
9.5.2	Setting the damping for OUT1.....	13
9.6	Service functions	13
9.6.1	Reading the min./max. values for the system pressure.....	13
10	Operation.....	13
10.1	Read the set parameter values	13
10.2	Fault indication	13
11	Scale drawing	14
12	Technical data.....	14
12.1	Setting ranges	16
13	Factory setting	17

1 Preliminary note

1.1 Symbols used

- ▶ Instruction
- > Reaction, result
- [...] Designation of buttons, switches or indications
- Cross-reference



Important note

Non-compliance can result in malfunctions or interference.

UK

2 Safety instructions

- Read this document before installing the unit. Ensure that the product is suitable for your application without any restrictions.
- Non-adherence to the operating instructions or technical data can lead to personal injury and/or damage to property.
- In all applications check compliance of the product materials (→ chapter 12 Technical data) with the media to be measured.
- For gaseous media the application is limited to max. 25 bar.

For units with cULus approval and the scope of validity cULus:

The device shall be supplied from an isolating transformer having a secondary Listed fuse rated as noted in the following table.

Overcurrent protection		
Control-circuit wire size		Maximum protective device rating Ampere
AWG	(mm ²)	
26	(0.13)	1
24	(0.20)	2
22	(0.32)	3
20	(0.52)	5
18	(0.82)	7
16	(1.3)	10

The Sensor shall be connected only by using any R/C (CYJV2) cord, having suitable ratings.

3 Functions and features

The unit monitors the system pressure of machines and installations.

Applications

Type of pressure: relative pressure

Order no.	Measuring range		Permissible overload pressure		Bursting pressure	
	bar	PSI	bar	PSI	bar	PSI
PN3000	0...400	0...5 800	600	8 700	1 000	14 500
PN3001	0...250	0...3 625	400	5 800	850	12 300
PN3002	0...100	0...1 450	300	4 350	650	9 400
PN3003	0...25	0...363	150	2 175	350	5 075
PN3004	-1...10	-14.5...145	75	1 087	150	2 175
PN3006	0...2.5	0...36.3	20	290	50	725
PN3007	0...1	0...14.5	10	145	30	450
PN3029	-1...0	-14.5...0	10	145	30	450
PN3060	0...600	0...8 700	800	11 600	1 200	17 400

MPa = bar ÷ 10 / kPa = bar × 100

Analogue measuring range for PN3004 = 0...10 bar.



Static and dynamic overpressures exceeding the indicated overload pressure are to be avoided by taking appropriate measures.

The indicated bursting pressure must not be exceeded. Even if the bursting pressure is exceeded only for a short time, the unit can be destroyed.

NOTE: Risk of injury!

For gaseous media the application is limited to max. 25 bar.

High-pressure units (400 bar, 600 bar) are supplied with an integrated damping device to comply with the regulations for UL approval and to avoid any risk of injury in case of bursting when bursting pressure is exceeded.

- When the damping device is removed the damping device can become unusable.
- When the damping device is removed the unit can no longer be used under UL conditions,

If you have any questions, please contact ifm electronic's sales specialists.

4 Function

4.1 Processing of the measured signals

- The unit shows the current system pressure on its display.
- It generates 2 output signals according to the parameter setting.

OUT1	switching signal for pressure limit values
OUT2	analogue signal 4..20 mA / 0..10 V

4.2 Switching function



OUT1 changes its switching state if it is above or below the set switching limits (SP1, rP1). The following switching functions can be selected:

- Hysteresis function / normally open: [OU1] = [Hno] (→ fig. 1).
- Hysteresis function / normally closed: [OU1] = [Hnc] (→ fig. 1).

First the set point (SP1) is set, then the reset point (rP1) at the requested distance.

- Window function / normally open: [OU1] = [Fno] (→ fig. 2).
- Window function / normally closed: [OU1] = [Fnc] (→ fig. 2).

The width of the window can be set by means of the distance between SP1 and rP1. SP1 = maximum value, rP1 = minimum value.

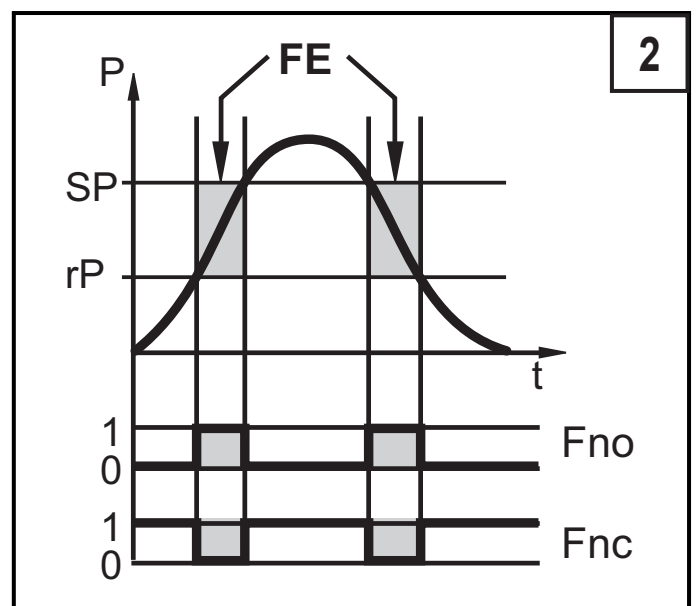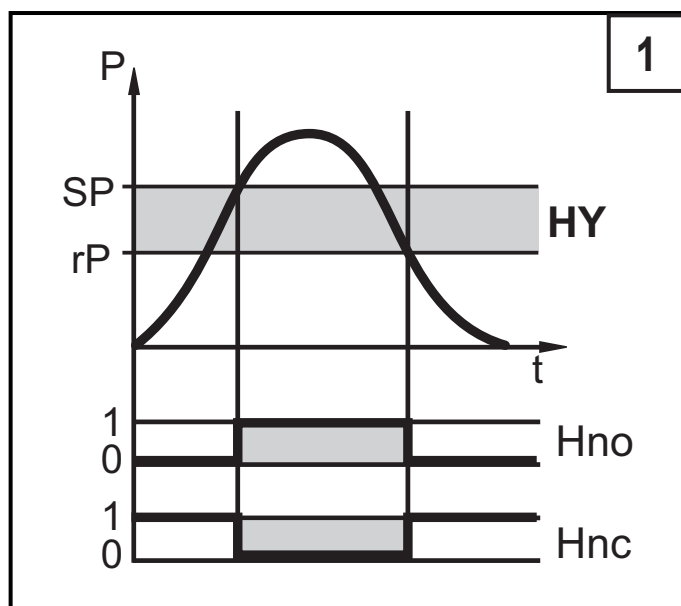

P = system pressure; HY = hysteresis; FE = window

4.3 Analogue function

The analogue output can be set:

- 4..20 mA ([OU2] = [I]), or
- 0..10 V ([OU2] = [U]).

Analogue measuring range for PN3004 = 0...10 bar.

5 Installation



Before mounting and removing the sensor, make sure that no pressure is applied to the system.

- ▶ Insert the unit in a G $\frac{1}{4}$ process connection.
- ▶ Tighten firmly.

6 Electrical connection




The unit must be connected by a qualified electrician.

The national and international regulations for the installation of electrical equipment must be adhered to.

Voltage supply to EN50178, SELV, PELV.

- ▶ Disconnect power.
- ▶ Connect the unit as follows:

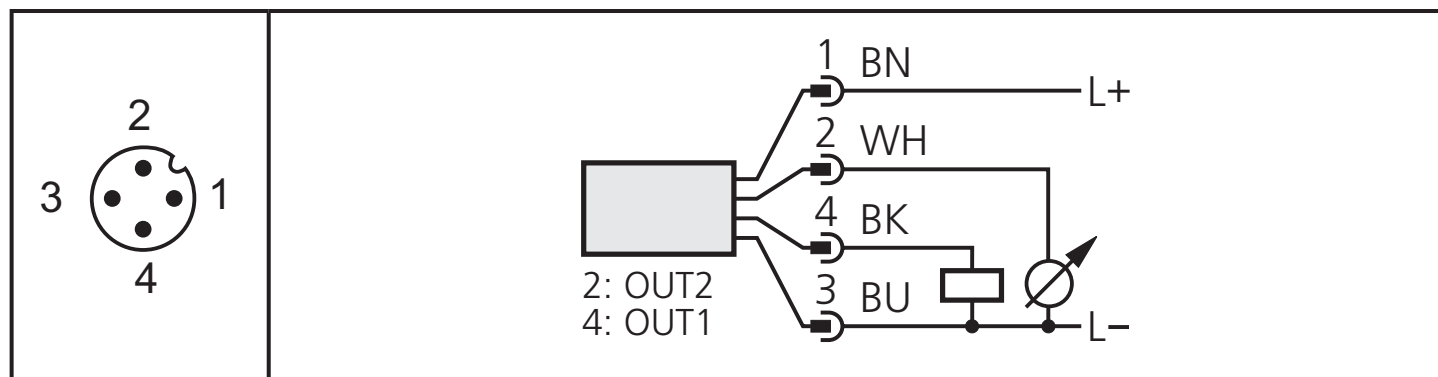


Pin 1	Ub+
Pin 3	Ub-
Pin 4 (OUT1)	switching output for pressure monitoring
Pin 2 (OUT2)	analogue output for system pressure

Core colours of ifm sockets:

1 = BN (brown), 2 = WH (white), 3 = BU (blue), 4 = BK (black).

7 Operating and display elements

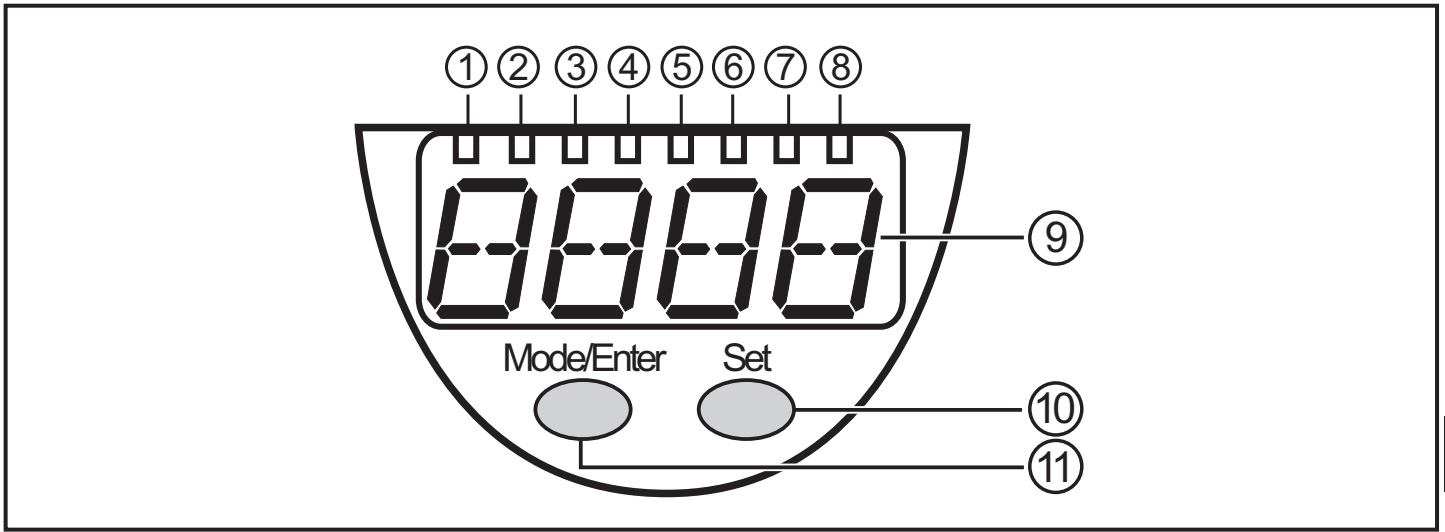

UK

1 to 8: Indicator LEDs

- LED 1 to LED 4 = system pressure in unit of measurement as indicated on the label.
- LED 4 not used for units with 3 adjustable units of measurement.
- LEDs 5 to 7 not used.
- LED 8 = switching state of the output.

9: Alphanumeric display, 4 digits

- Indication of the current system pressure.
- Indication of the parameters and parameter values.

10: Set pushbutton


- Setting of the parameter values (scrolling by holding pressed, incremental by pressing briefly).

11: Mode/Enter pushbutton

- Selection of the parameters and acknowledgement of the parameter values.

8 Menu

8.1 Menu structure

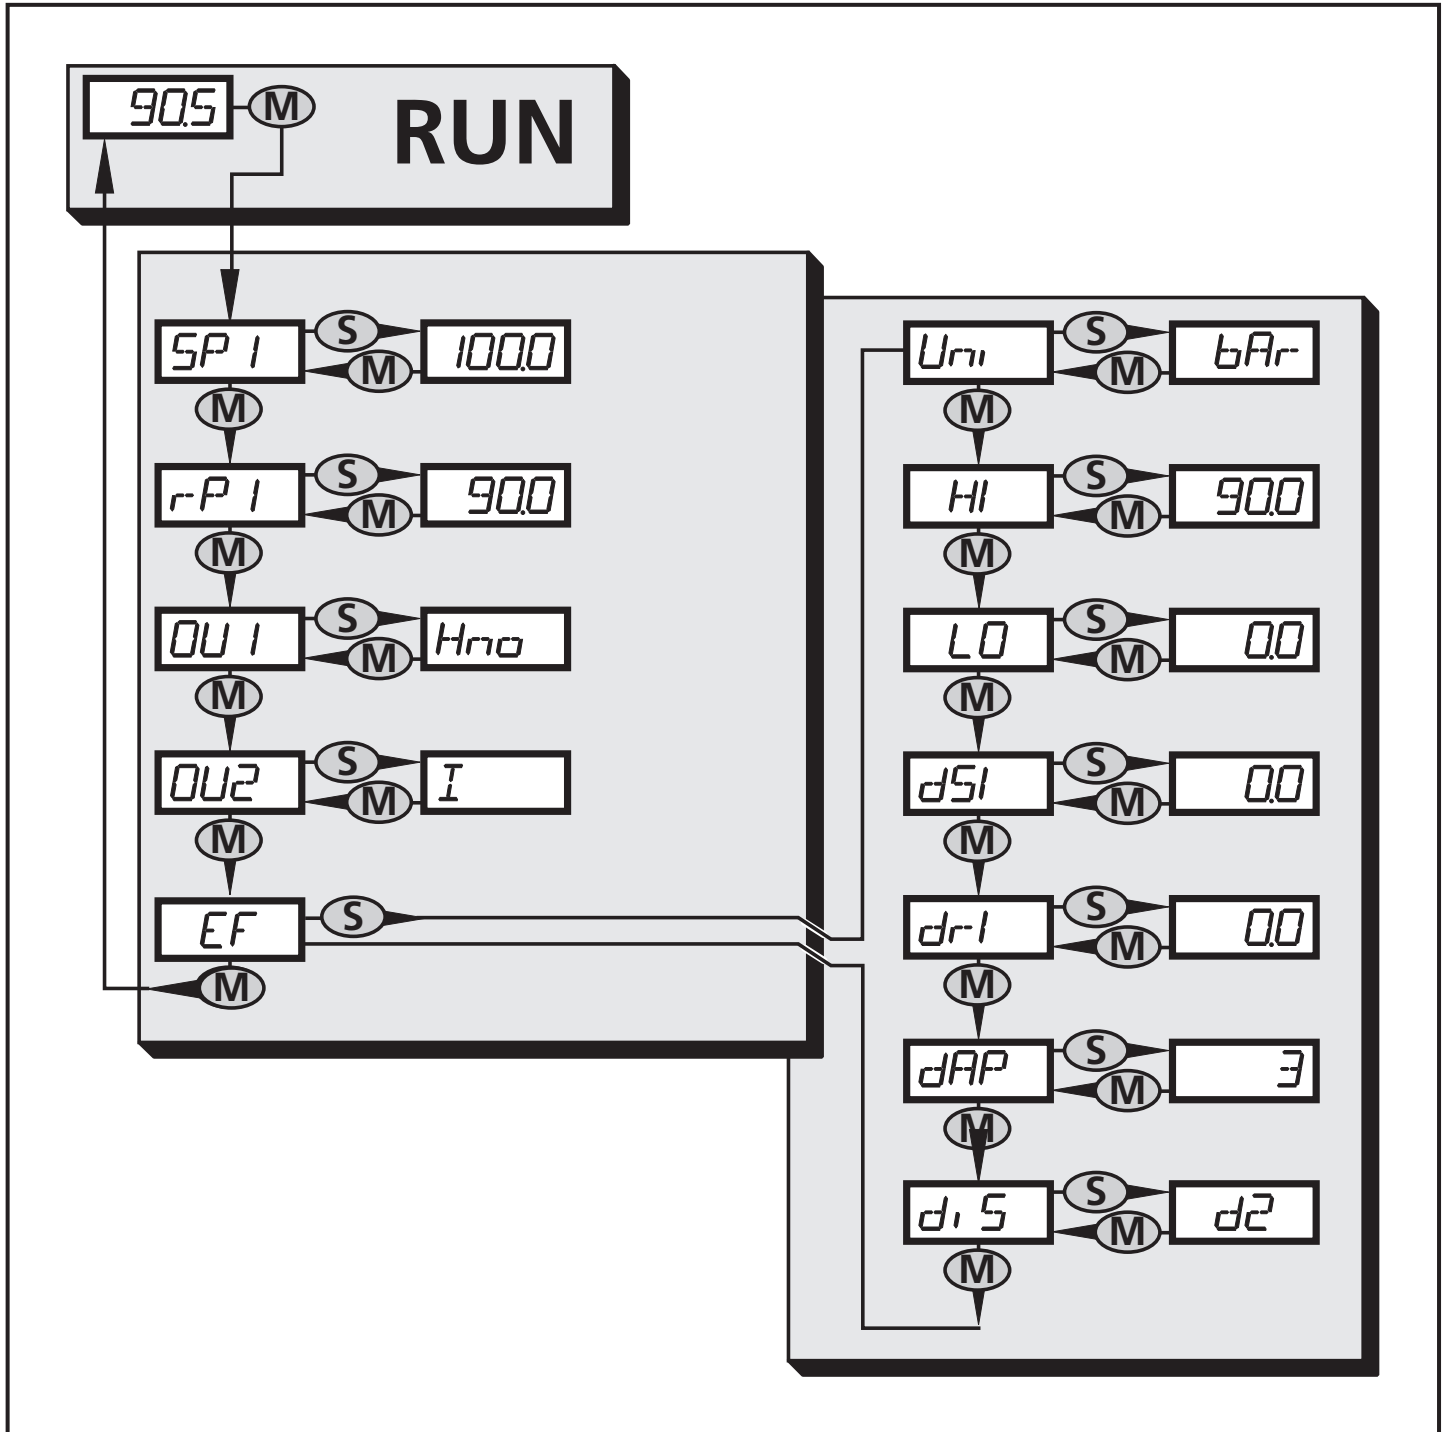

8.2 Explanation of the menu

SP1/rP1	Maximum / minimum value for system pressure, at which output 1 changes its switching status.
OU1	Output function for OUT1: <ul style="list-style-type: none"> • Switching signal for the limit values: hysteresis function [H ..] or window function [F ..], normally open [. no] or normally closed [. nc] each.
OU2	Output function for OUT2: <ul style="list-style-type: none"> • Analogue signal for the current system pressure: 4...20 mA [I] or 0...10 V [U].
EF	Extended functions / Opening menu level 2.
Uni	Standard unit of measurement for the system pressure.
HI	Maximum value memory for the system pressure.
LO	Minimum value memory for the system pressure (only PN3004 and PN3029).
dS1	Switch-on delay for für OUT1.
dr1	Reset delay für OUT1.
dAP	Damping for OUT1.
diS	Update rate and orientation of the display.


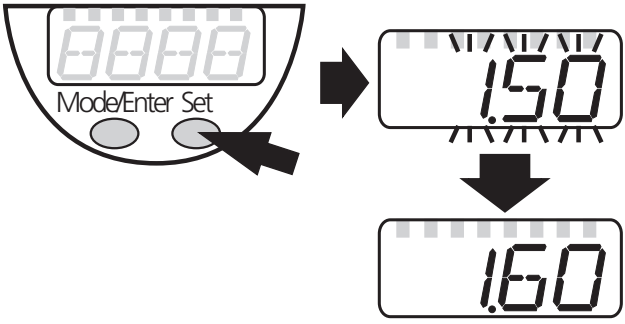
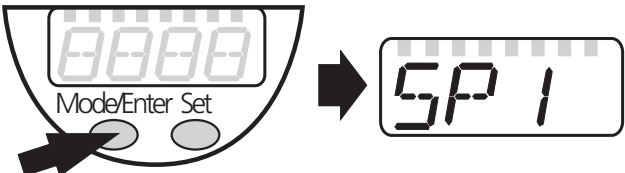
UK

9 Parameter setting



During the parameter setting process the unit remains in the operating mode. It continues its monitoring function with the existing parameters until parameter setting has been terminated.

9.1 Parameter setting general

Each parameter setting requires 3 steps:

<p>1</p>	<p>Selecting parameter</p> <ul style="list-style-type: none"> ▶ Press [Mode/Enter] until the requested parameter is displayed. 	
<p>2</p>	<p>Setting the parameter value</p> <ul style="list-style-type: none"> ▶ Press [Set] and keep the button pressed. > Current setting value of the parameter bit flashes for 5 s. > After 5 s: Setting value is changed: incremental by pressing briefly or scrolling by holding pressed. 	
<p>The numerical values are incremented continuously. If the value is to be reduced: Let the display move to the maximum setting value. Then the cycle starts again at the minimum setting value.</p>		
<p>3</p>	<p>Acknowledge parameter value</p> <ul style="list-style-type: none"> ▶ Press [Mode/Enter] briefly. > The parameter is displayed again. The new setting value is stored. 	
<p>Set more parameters:</p> <ul style="list-style-type: none"> ▶ Start again with step 1. 		
<p>Finishing parameter setting:</p> <ul style="list-style-type: none"> ▶ Press [Mode/Enter] several times until the current measured value is displayed or wait for 15 s. > The unit returns to the operating mode. 		



- Changing from menu level 1 to menu level 2:
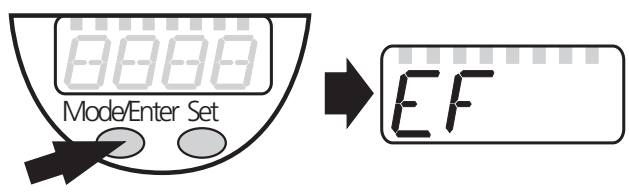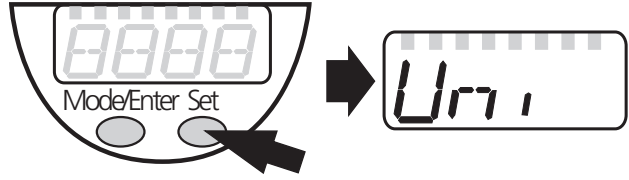
<ul style="list-style-type: none"> ▶ [Press [Mode/Enter] until [EF] is displayed. <p>If the submenu is protected with an access code, [Cod1] flashes in the display.</p> <ul style="list-style-type: none"> ▶ Press [Set] and hold it pressed until the valid code no. is shown. ▶ Then briefly press [Mode/Enter]. <p>Delivery by ifm electronic: no access restriction.</p>	
<ul style="list-style-type: none"> ▶ Press [Set] briefly. > The first parameter of the submenu is displayed (here: [Uni]). 	

UK

- Locking / unlocking

The unit can be locked electronically to prevent unintentional wrong settings.
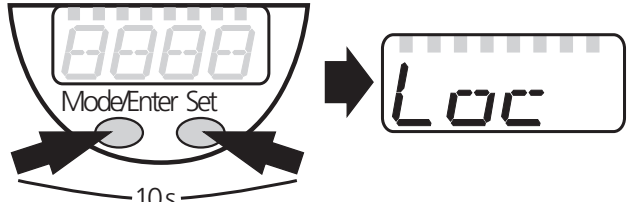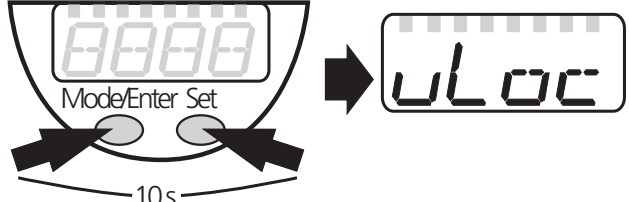
<ul style="list-style-type: none"> ▶ Ensure that the unit is in the normal operating mode. ▶ Press [Mode/Enter] + [Set] for 10 s. > [Loc] is displayed. 	
<p>During operation [Loc] is displayed briefly when you try to change parameter values.</p>	
<p>For unlocking:</p> <ul style="list-style-type: none"> ▶ Press [Mode/Enter] + [Set] for 10 s. > [uLoc] is displayed. 	

On delivery: Unlocked.

- Timeout:

If no button is pressed for 15 s while the parameters are being set, the unit returns to the operating mode with unchanged values.

9.2 Configuring the display (optional)

<ul style="list-style-type: none"> ▶ Select [Uni] and set the unit of measurement: [bar], [mbar], [MPa], [kPa], [PSI], for PN3007 and PN3029 in addition [inHg]. 	<i>Uni</i>
<ul style="list-style-type: none"> ▶ Select [diS] and set update rate and orientation of the display: <ul style="list-style-type: none"> - [d1]: Update of the measured value every 50 ms. - [d2]: Update of the measured value every 200 ms. - [d3]: Update of the measured value every 600 ms. - [rd1], [rd2], [rd3]: Display like d1, d2, d3; rotated by 180°. - [OFF]: The display is deactivated in the operating mode. 	<i>d1 5</i>

9.3 Configuration of output 1

9.3.1 Setting the output function

<ul style="list-style-type: none"> ▶ Select [OU1] and set the switching function: <ul style="list-style-type: none"> - [Hno] = hysteresis function / normally open, - [Hnc] = hysteresis function / normally closed, - [Fno] = window function / normally open, - [Fnc] = window function / normally closed. 	<i>OU 1</i>
--	-------------

9.3.2 Setting the switching limits

<ul style="list-style-type: none"> ▶ Select [SP1] and set the value at which the output switches. 	<i>SP 1</i>
<ul style="list-style-type: none"> ▶ Select [rP1] and set the value at which the output switches back. rP1 is always lower than SP1. The unit only accepts values which are lower than SP1. 	<i>r-P 1</i>

9.4 Configuration of output 2


<ul style="list-style-type: none"> ▶ Select [OU2] and set the analogue function: <ul style="list-style-type: none"> - [I] = current signal proportional to the pressure 4...20 mA, - [U] = voltage signal proportional to the pressure 0..10 V. 	<i>OU2</i>
--	------------

9.5 User settings (optional)

9.5.1 Setting the delay time for OUT1

<p>[dS1] = switch-on delay, [dr1] = switch-off delay.</p> <ul style="list-style-type: none"> ▶ Select [dS1] or [dr1] set value between 0.1 und 50 s (at 0.0 the delay time is not active). 	<i>dS 1</i> <i>dr 1</i>
---	----------------------------


9.5.2 Setting the damping for OUT1

<p>▶ Select [dAP], set value. dAP-value = response time between pressure change and change of the switching status in milliseconds (ms). The following values can be set. They define the switching frequency (f) of the output:</p>										
dAP	3	6	10	17	30	60	125	250	500	
f [Hz]	170	80	50	30	16	8	4	2	1	

9.6 Service functions

9.6.1 Reading the min./max. values for the system pressure

UK

<p>▶ Select [HI] or [LO], press [Set] briefly. [HI] = maximum value, [LO] = minimum value. Delete memory:</p> <p>▶ Select [HI] or [LO]. ▶ Press [Set] until [----] is displayed. ▶ Press [Mode/Enter] briefly. [LO] is available only for PN3004 and PN3029.</p>										

10 Operation

After power on of the supply voltage the unit is in the Run mode (= normal operation). It carries out its measurement and evaluation functions and generates output signals according to the set parameters.

Operation indication → chapter 7 Operating and display elements.

10.1 Read the set parameter values


- ▶ Press [Mode/Enter] briefly until the requested parameter is displayed.
- ▶ Press [Set] briefly.
- > The unit indicates the corresponding parameter value for 15 s. After another 15 s the unit returns to the Run mode.

10.2 Fault indication

[OL]	overload pressure (measuring range exceeded)
[UL]	underpressure range (measuring range below the minimum value)
[SC1]	short circuit in OUT1; the output is switched off as long as the short circuit exists
[Err]	(flashing) internal fault

The faults SC1 and Err are indicated even if the display is deactivated.

11 Scale drawing

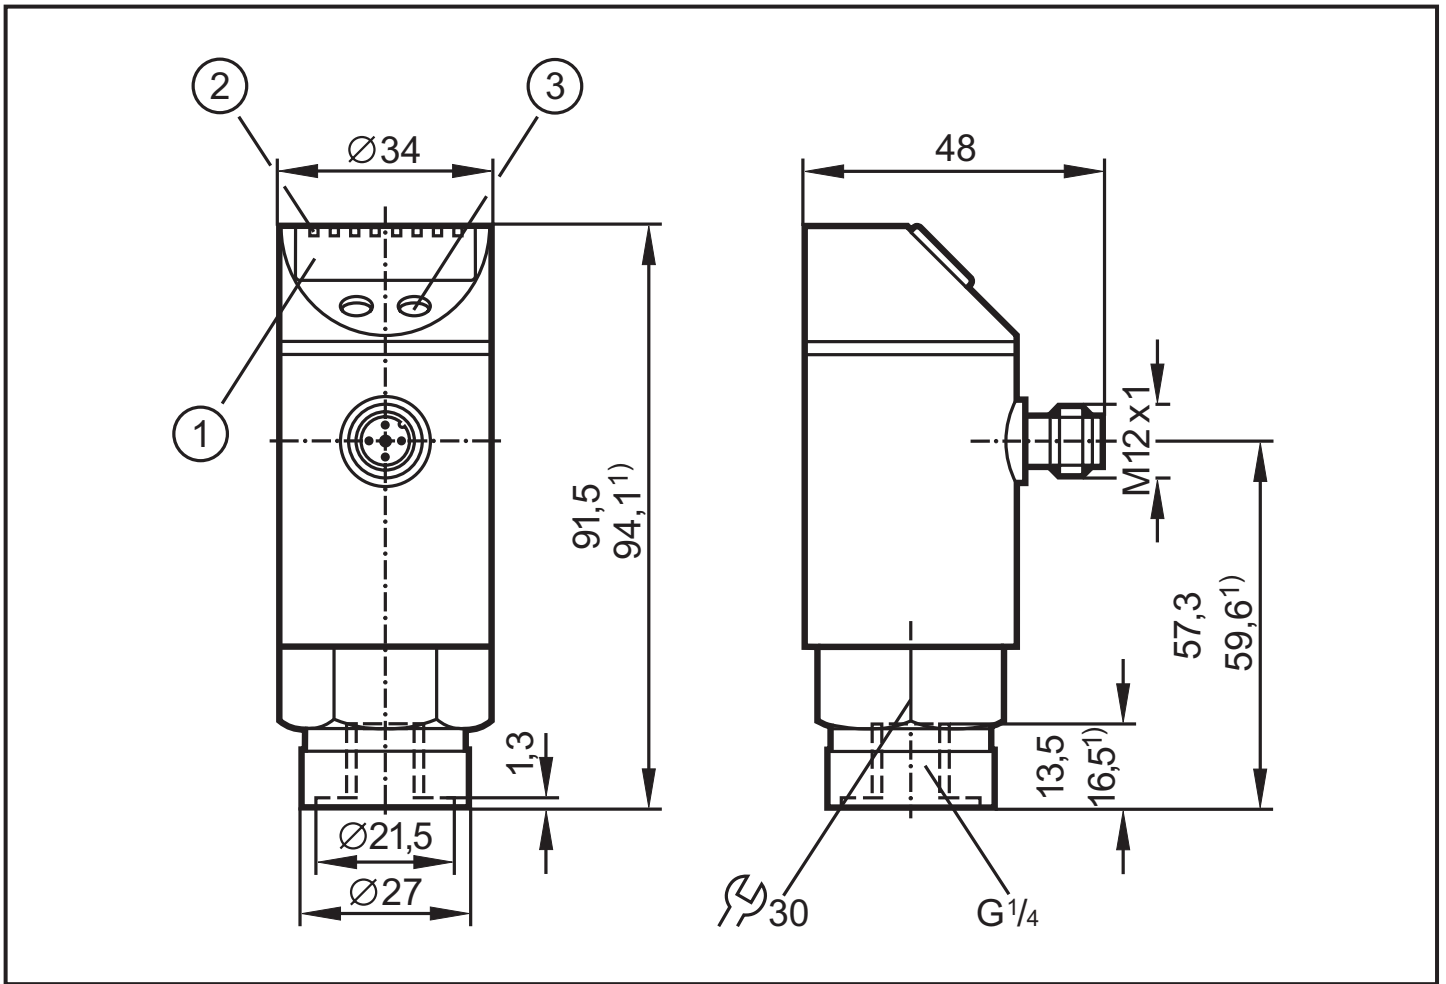

Dimensions are in millimeters

¹⁾ = dimensions for PN3000 and PN3060

1: display

2: LED's

3: programming button

12 Technical data

Operating voltage [V]	18...36 DC ¹⁾
Current rating [mA]	250
Current consumption [mA]	< 50
Reverse polarity and overload protected	up to 40 V
Short-circuit protected; Watchdog	
Voltage drop [V]	< 2
Power-on delay time [s]	0.3
Switching frequency [Hz]	max.170
Analogue output	4...20 mA / 0...10 V
Max. load current output [Ω]	500
Min. load with voltage output [Ω]	2000
Response time analog output [ms]	< 3

Accuracy / deviations (in % of the span)

- Accuracy of switch point	< ± 0.5
- Characteristics deviation	< ± 0.25 (BFSL) / < ± 0.5 (LS)
- Hysteresis.....	< 0.25 (0.5 for PN3060)
- Repeatability (with temperature fluctuations < 10K).....	< ± 0.1
- Long-time stability (in% of the span per year).....	< ± 0.05
- Temperature coefficients (TEMPCO) in the compensated temperature range 0 ... +80°C (in% of the span per 10 K)	
- greatest TEMPCO of the zero point / of the span	< ± 0.2 / < ± 0.2

Materials (wetted parts)	stainless steel (303S22); ceramics; FPM (Viton)
Housing material	stainless steel (304S15); stainless steel 316L / 1.4404; PC (Makrolon); PBTP (Pocan); PEI; FPM (Viton); EPDM/X (Santoprene) ²⁾
Protection	IP 67 III ³⁾
Protection	IP 65 III ⁴⁾
Insulation resistance [MΩ]	> 100 (500 V DC)
Shock resistance [g]	50 (DIN / IEC 68-2-27, 11ms)
Vibration resistance [g]	20 (DIN / IEC 68-2-6, 10 - 2000 Hz)
Switching cycles min.	100 million (50 million for PN3060)
Operating temperature [°C]	-20...80 (UB < 32 V) / -20...60 (UB > 32 V)
Medium temperature [°C]	-25 ... +80
Storage temperature[°C].....	-40 ... +100
EMC EN 61000-4-2 ESD:	4 / 8 KV
EN 61000-4-3 HF radiated:	10 V/m
EN 61000-4-4 Burst:	2 KV
EN 61000-4-5 Surge:	0.5 / 1 KV
EN 61000-4-6 HF conducted:	10 V

UK

1) to EN50178, SELV, PELV

2) in addition PTFE for PN3003...PN3007, PN3029

3) for PN3000...PN3002, PN3060

4) for PN3003...PN3007, PN3029

BFSL = Best Fit Straight Line / LS = Limit Value Setting

12.1 Setting ranges

		SP1		rP1		ΔP
		min	max	min	max	
PN3000	bar	4	400	2	398	2
	PSI	60	5790	30	5760	30
	MPa	0.4	40.0	0.2	39.8	0.2
PN3001	bar	2	250	1	249	1
	PSI	40	3620	20	3600	20
	MPa	0.2	25.0	0.1	24.9	0.1
PN3002	bar	1.0	100.0	0.5	99.5	0.5
	PSI	20	1450	10	1440	10
	MPa	0.10	10.00	0.05	9.95	0.05
PN3003	bar	0.2	25.0	0.1	24.9	0.1
	PSI	4	362	2	360	2
	MPa	0.02	2.50	0.01	2.49	0.01
PN3004	bar	-0.90	10.00	-0.95	9.95	0.05
	PSI	-12	145	-13	144	1
	MPa	-0.090	1.000	-0.095	0.995	0.005
PN3006	bar	0.02	2.50	0.01	2.49	0.01
	PSI	0.4	36.2	0.2	36.0	0.2
	kPa	2	250	1	249	1
PN3007	mbar	10	1000	5	995	5
	PSI	0.2	14.5	0.1	14.4	0.1
	kPa	1.0	100.0	0.5	99.5	0.5
	inHg	0.3	29.5	0.2	29.4	0.1
PN3029	mbar	-990	0	-995	-5	5
	PSI	-14.3	0.0	-14.4	-0.1	0.1
	kPa	-99.0	0.0	-99.5	-0.5	0.5
	inHg	-29.2	0.0	-29.3	-0.2	0.1

ΔP = increment

		SP1		rP1		ΔP
		min	max	min	max	
PN3060	bar	6	600	3	597	3
	PSI	100	8700	50	8650	50
	MPa	0.6	60.0	0.3	59.7	0.3

ΔP = increment

13 Factory setting

UK

	Factory setting	User setting
SP1	25% VMR*	
rP1	23% VMR*	
OU1	Hno	
OU2	I	
dS1	0.0	
dr1	0.0	
dAP	60	
diS	d2	
Uni	bAr / mbAr	

* = the indicated percentage of the final value of the measuring range (VMR) of the corresponding sensor in bar / mbar is set.

More information at www.ifm.com