


Fiber optic through beam sensor

FE-00-A-A-M4

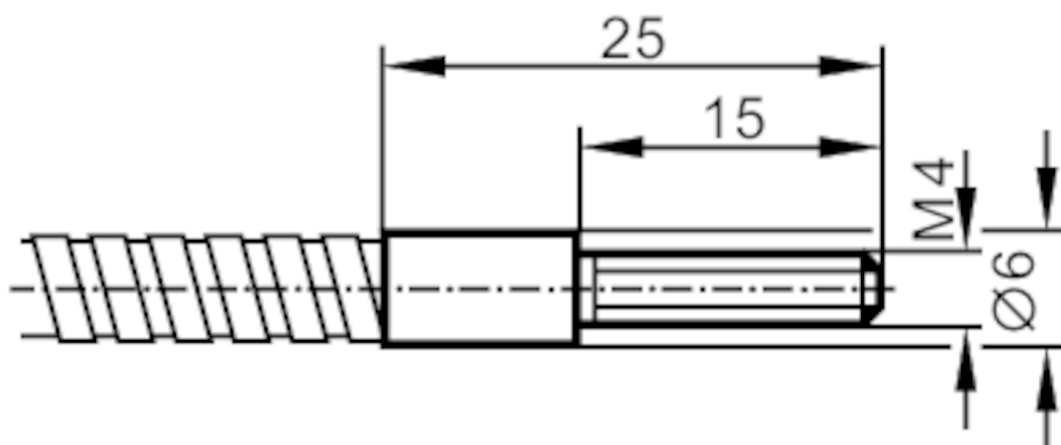

Application

Function principle	Through-beam sensor
Application	High temperature resistance; Robust design for use in harsh industrial environments

Monitoring range

Range with fiber optic amplifier type	OCF; OKF; OOF; OUF
---------------------------------------	--------------------

OCF (High Power)

Range of fiber optics [mm]	1200
----------------------------	------

OKF

Range of fiber optics [mm]	120
----------------------------	-----

OOF

Range of fiber optics [mm]	400
----------------------------	-----

OUF

Range of fiber optics [mm]	120
----------------------------	-----

Operating conditions

Ambient temperature [°C]	-40...290
--------------------------	-----------

Mechanical data

Weight [g]	56
Version of sensing head	straight
Sensing head thread	M4

E20128



Fiber optic through beam sensor

FE-00-A-A-M4

Sensing head length	[mm]	15
Total length	[mm]	600
Min. bending radius	[mm]	20; (for fixed installation)
Fiber arrangement		
Material		Adapter: ABS
Fiber material		glass
Fiber head material		aluminum
Fiber sheath material		aluminum

Accessories

Items supplied	Hexagon nuts: 4 x M4
	tooth lock washers: 4
	Knurled nut: 1 x M11

Remarks

Pack quantity	1 pcs.
---------------	--------