


ZB0037



AS-Interface motor starter for three-phase motors

PowerSwitch 3,2A 1,1KW

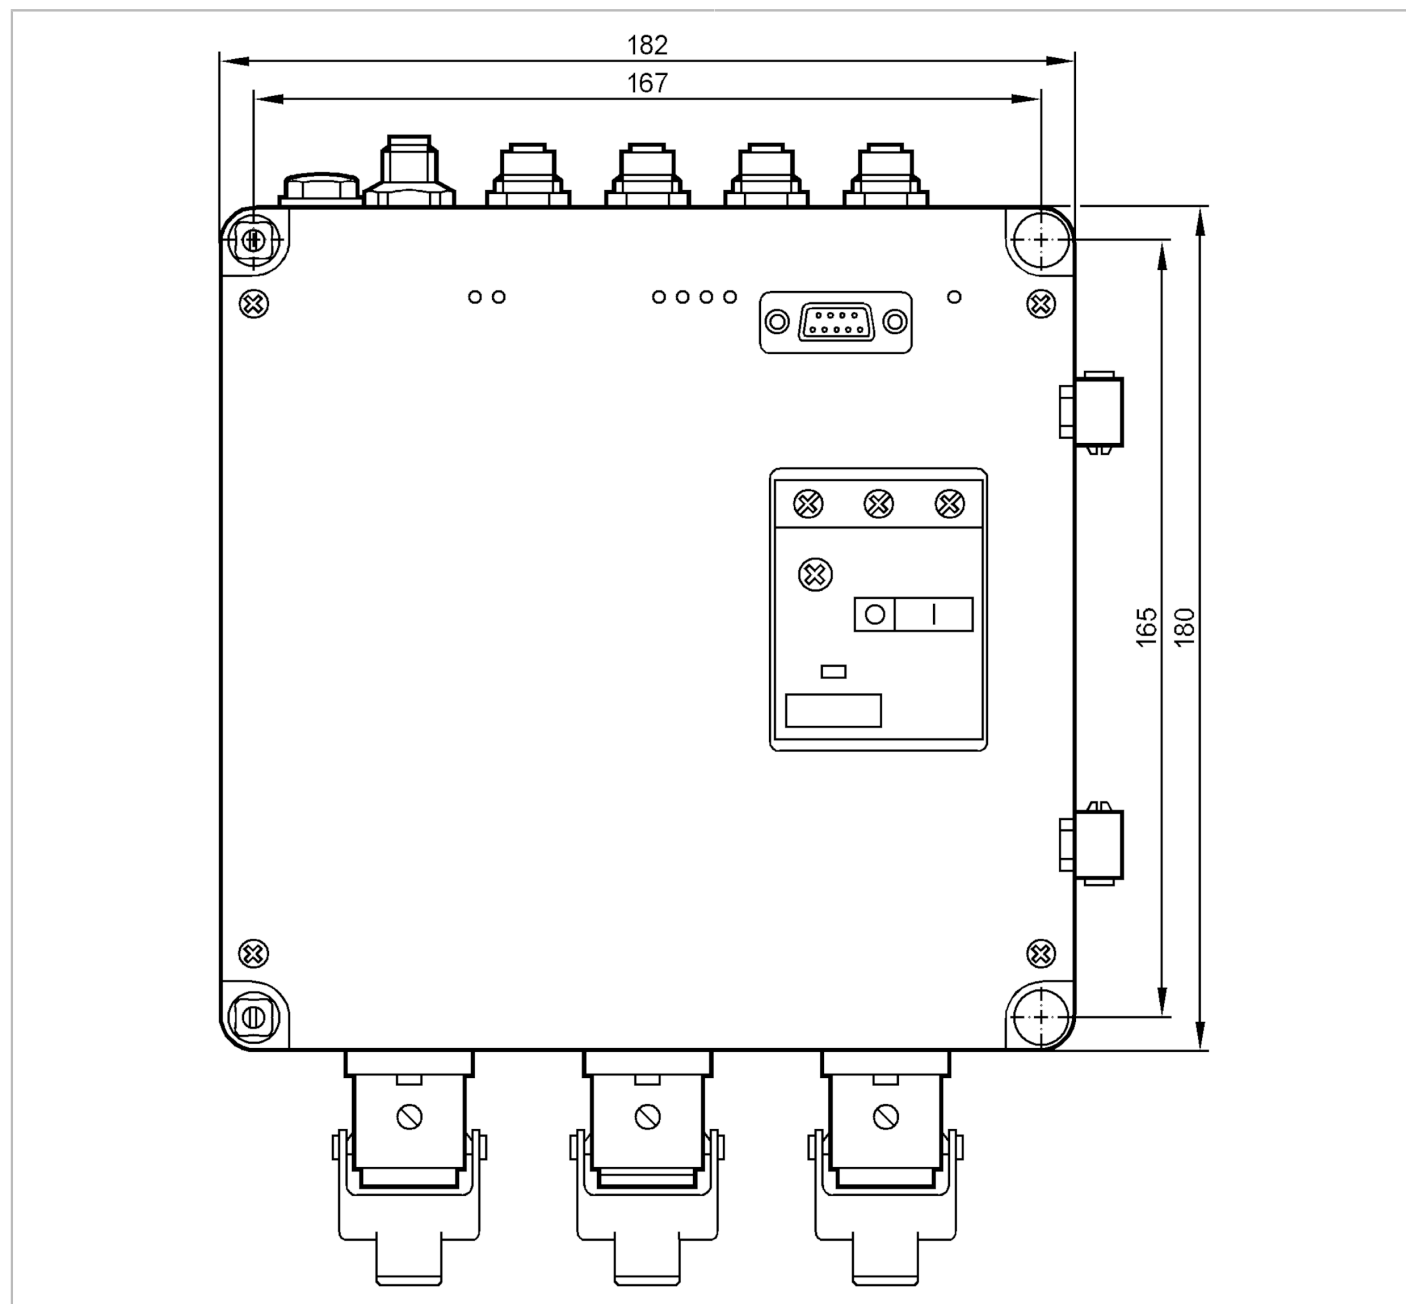

Electrical data

Operating voltage	[V]	26.5...31.6 DC
Max. current consumption from AS-i	[mA]	250
Max. current load total	[A]	0.3
Integrated watchdog		yes

Inputs / outputs

Number of inputs and outputs	Number of digital inputs: 4; Number of digital outputs: 4
------------------------------	---

Inputs

Number of digital inputs	4
--------------------------	---



AS-Interface motor starter for three-phase motors

PowerSwitch 3,2A 1,1KW

Input circuit of digital inputs	PNP
Sensor supply of the inputs	AS-i
Power supply [V]	20...30
Max. total current rating of inputs [mA]	140
Input current High [mA]	6...10
Input current Low [mA]	0...2
Switching level high [V]	> 10
Digital inputs protected against short circuits	yes

Outputs

Electrical design	AS-i
Number of digital outputs	4
Voltage range DC [V]	18...30; (to PELV)
Voltage range AC [V]	110...400
Max. current load per output [mA]	150; (external outputs: Short-circuit proof; reversing contactor: not protected against short circuits)
Electrically separated	yes

Operating conditions

Ambient temperature [°C]	0...60
Protection	IP 54

Tests / approvals

EMC	EN 50081-1	
	EN 61000-6-2	

AS-i classification

AS-i version	2.0
Extended addressing mode	no
AS-i profile	S-7.0
AS-i I/O configuration [hex]	7
AS-i ID code [hex]	0

Mechanical data

Weight [g]	1855
Type of mounting	backplane mounting
Dimensions [mm]	180 x 182 x 90
Materials	PC glass fibre reinforced; flame-retardant; UV resistant

Displays / operating elements

Display	switching status	LED, yellow
	operation	LED, green
	errors	LED, red

Remarks

Remarks	The PowerSwitch motor starter uses two outputs to trigger the reversing contactors (motor right/left/off).
	Two further outputs can be connected at will.
	The messages "motor protection activated" and "hand-held operating panel connected" are indicated via the input data bits.
	Sensors can be connected to two additional inputs.

**AS-Interface motor starter for three-phase motors**

PowerSwitch 3,2A 1,1KW

Pack quantity

1 pcs.

Electrical connection

	400 V connection and motor socket
L1	contact number 1
L2	contact number 2
L3	contact number 3
PE	prepared for PE
	supply voltage connector
1	AS-i +
2	24V DC -
3	AS-i -
4	24V DC +
	output socket 2 x M12
1	I+
2/4	input bridged
3	I-
	output socket 2 x M12
1	n.c.
2	n.c.
3	24V DC -
4	switching output 24V DC +