




Fibre optic through-beam sensor

FE-11-EPA-M4/F1x1/2M

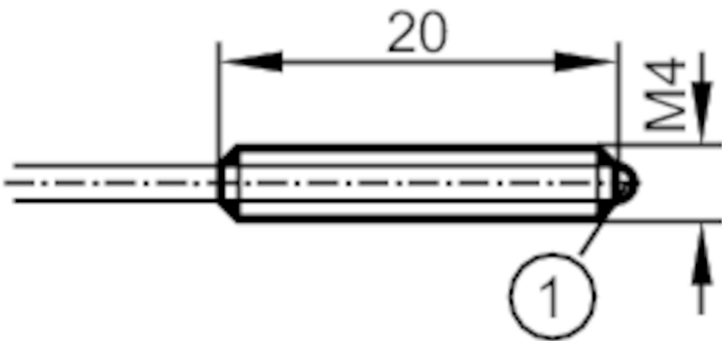

1 glass lens

Application		
Function principle	Through-beam sensor	
Application	For use in industrial environments	
Detection zone		
Range with fibre-optic amplifier type	OB50; OBF; OCF; OO50	
OB50		
Range of fibre optics	[mm]	400
OBF		
Range of fibre optics	[mm]	900
OCF (High Power)		
Range of fibre optics	[mm]	4000
OO50		
Range of fibre optics	[mm]	1600
Operating conditions		
Ambient temperature	[°C]	-40...70
Mechanical data		
Weight	[g]	47.5
Version of sensing head	straight	
Sensing head thread	M4	

E20753



Fibre optic through-beam sensor

FE-11-EPA-M4/F1x1/2M

Total length	[mm]	2000
Min. bending radius	[mm]	30
Fibre arrangement		●
Core diameter	[mm]	1
Fibre material		PMMA
Fibre head material		aluminium
Fibre sheath material		PE

Accessories

Items supplied	hexagon nuts: 4 x M4 tooth lock washers: 4
Accessories (optional)	Cutter for fibre optics:, E20600

Remarks

Pack quantity	1 pcs.
---------------	--------