
OG0029

Through-beam sensor receiver

OGE-HBOA





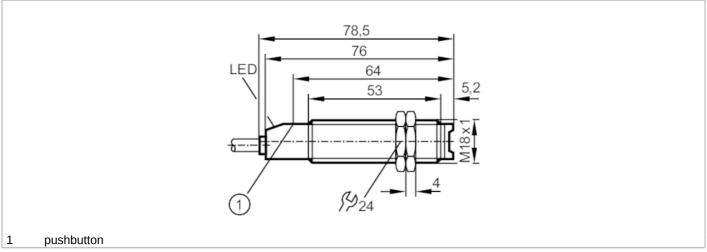

Product characteristics				
Type of light		Infrared light		
Housing		Threaded type		
Application				
Function principle		Through-beam sensor		
Electrical data				
Frequency AC	[Hz]	4763		
Operating voltage	[V]	20250 AC/DC		
Protection class		II		
Reverse polarity protection		no		
Type of light		Infrared light		
Wave length	[nm]	880		
Outputs				
Output function		light-on mode		
Max. voltage drop switching output DC	[V]	8		
Max. voltage drop switching output AC	[V]	8		
Minimum load current	[mA]	5		
Max. leakage current	[mA]	1.7		
Permanent current rating of switching output AC	[mA]	90; (180 (40 °C))		
Permanent current rating of switching output DC	[mA]	90; (180 (40 °C))		
Short-time current rating of switching output	[mA]	600; (20 ms / 0,5 Hz)		
Switching frequency AC	[Hz]	25		
Switching frequency DC	[Hz]	25		
Short-circuit proof		no		
Overload protection		no		

OG0029

Through-beam sensor receiver





Monitoring range					
Transmitter / receiver		receiver			
Range	[m]	< 15			
Range adjustable		yes			
Operating conditions					
Ambient temperature	[°C]	-2580			
Protection		IP 67			
Tests / approvals					
EMC		EN 60947-5-2			
		EN 55011	class B		
MTTF	[years]		334		
Mechanical data					
Weight	[g]	121.7			
Housing		Threaded type			
Dimensions	[mm]	M18 x 1 / L = 78.5			
Thread designation		M18 x 1			
Material		PBT			
Lens material		РММА			
Displays / operating eler	ments				
Display		Switching status	1 x LED, red		
		Function	1 x LED, red flashing		
Electrical connection					
Required protection		miniature fuse to IEC60127-2 sheet 1; \leq 2 A; fast acting			
Accessories					
Items supplied		lock nuts: 2			
Remarks					
Remarks		Recommendation: check the unit for reliable function after a short circuit.			
Pack quantity		1 pcs.			

OG0029

Through-beam sensor receiver


OGE-HBOA



Electrical connection

Cable: 2 m, PVC; 2 x 0.5 mm²

Connection

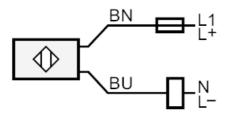

Note: miniature fuse to IEC60127-2 sheet $1 \le 2$ A fast acting

Core colors:

BN = brown BU = blue

Diagrams and graphs

excess gain graph

