


# TW2101



## Infrared temperature sensor

TW-100KLBM30-KFDKG/US

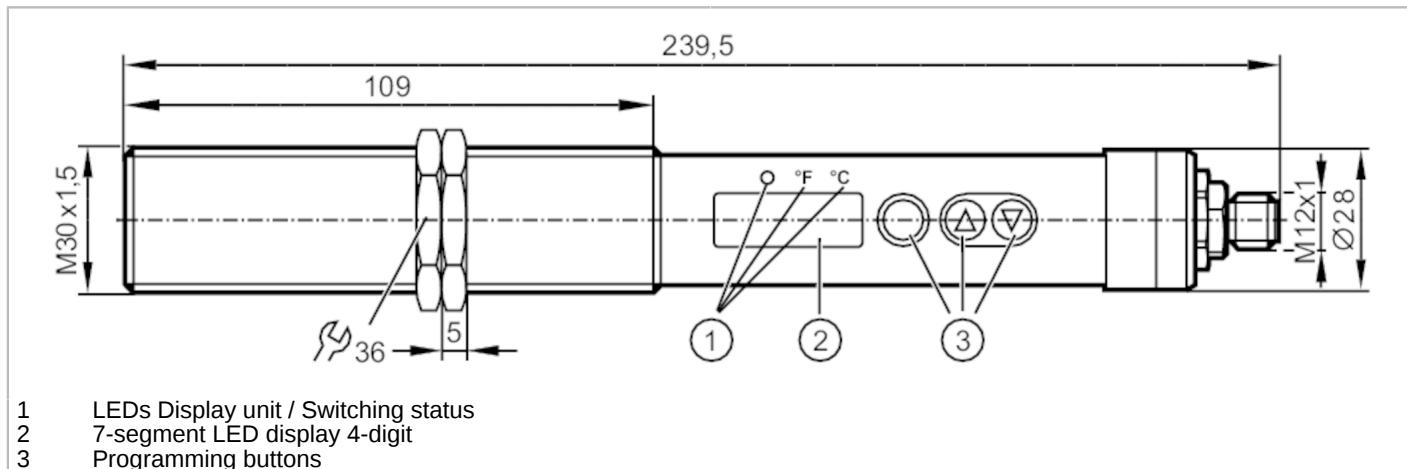

### Product characteristics

Number of inputs and outputs	Number of digital outputs: 1; Number of analog outputs: 1	
Measuring range	250...1600 °C	482...2912 °F
Communication interface	IO-Link	

### Application

Application	tempering temperatures; glass melting; graphite; ceramics; metals; forging; sintering; heat treatment; rolling
-------------	--

### Electrical data

Operating voltage	[V]	18...32 DC; (to SELV/PELV)
Current consumption	[mA]	< 50
Min. insulation resistance	[MΩ]	100; (50 V DC)
Protection class		III
Reverse polarity protection		yes
Power-on delay time	[s]	< 1

### Inputs / outputs

Number of inputs and outputs	Number of digital outputs: 1; Number of analog outputs: 1
------------------------------	---

### Inputs

Test input	type 3 (IEC 61131-2)
------------	----------------------

### Outputs

Total number of outputs	2
Output signal	switching signal; analog signal; IO-Link; (configurable)
Electrical design	PNP
Number of digital outputs	1
Output function	normally open / closed; (configurable)
Max. voltage drop switching output DC	[V] 2.5
Permanent current rating of switching output DC	[mA] 150
Number of analog outputs	1
Analog current output	[mA] 4...20

# TW2101



## Infrared temperature sensor

TW-100KLBM30-KFDKG/US

Max. load	[Ω]	500
Short-circuit protection		yes
Type of short-circuit protection		yes (non-latching)
Short-circuit proof		yes
Overload protection		yes
<b>Monitoring range</b>		
Wave length range	[μm]	1...1.7
<b>Measuring/setting range</b>		
Measuring range	250...1600 °C	482...2912 °F
Set point SP	251...1600 °C	484...2912 °F
Reset point rP	250...1599 °C	482...2910 °F
Analog start point	250...1400 °C	482...2552 °F
Analog end point	450...1600 °C	842...2912 °F
In steps of	1 °C	1 °F
<b>Resolution</b>		
Resolution of switching output	[K]	1
Resolution of analog output	[K]	0.2; (+ 0.03 % of the set measuring span)
Resolution of display	[K]	1
<b>Accuracy / deviations</b>		
Accuracy	[K]	< ± 0.5 %; (of measured value, min. 4 K (degree of emission = 1, T = 23 °C))
Repeatability	[K]	1
<b>Reaction times</b>		
Response time	[ms]	2; (T > 600 °C)
<b>Software / programming</b>		
Adjustment of the switch point		Programming buttons
Parameter setting options		Analog range; normally open / closed; switch-on/switch-off delay; Damping; Peakhold; emissivity; simulation function
<b>Interfaces</b>		
Communication interface		IO-Link
Transmission type		COM2 (38,4 kBaud)
IO-Link revision		1.1
SDCI standard		IEC 61131-9
SIO mode		yes
Required master port class		A
Process data analog		16
Process data binary		1
Min. process cycle time	[ms]	3.6
Supported DeviceIDs		
	<b>Type of operation</b>	<b>DeviceID</b>
	default	717
<b>Operating conditions</b>		
Ambient temperature	[°C]	0...65
Storage temperature	[°C]	-20...80

# TW2101



## Infrared temperature sensor

TW-100KLBM30-KFDKG/US


Max. relative air humidity	[%]	95; (non condensing)
Protection		IP 65
<b>Tests / approvals</b>		
EMC		DIN EN 61000-6-2
		DIN EN 61000-6-4
Shock resistance		DIN EN 60068-2-27
Vibration resistance		DIN EN 60068-2-6
<b>Mechanical data</b>		
Weight	[g]	509
Housing		Threaded type
Dimensions	[mm]	M30 x 1.5 / L = 239.5
Thread designation		M30 x 1.5
Material		threaded sleeve: stainless steel (1.4305 / 303); polyester
Lens material		tempered optical glass
<b>Displays / operating elements</b>		
Display	Display unit	2 x LED, yellow
	Switching status	1 x LED, yellow
	Function display	7-segment LED display, 4-digit
	Measured values	7-segment LED display, 4-digit
	Setting aid	LED pilot light, green
Operating elements	3	Pushbuttons
<b>Accessories</b>		
Items supplied		lock nuts: 2
<b>Remarks</b>		
Remarks	Use a screened cable to protect infrared temperature sensors from interference.	
	The screen must be connected to the housing of the sensor via the connector.	
Pack quantity		1 pcs.

## Infrared temperature sensor

TW-100KLBM30-KFDKG/US

### Electrical connection

#### Connection

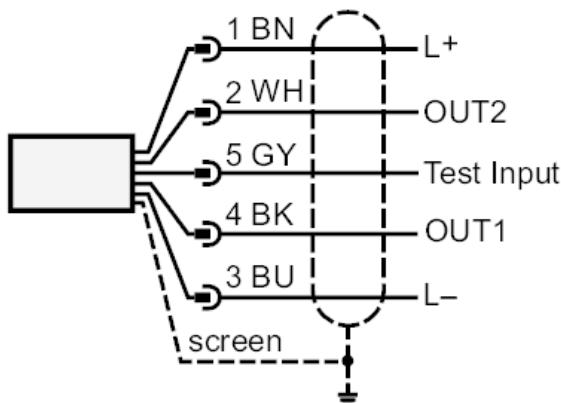

OUT1: Switching output / IO-Link

OUT2: analog output

Core colors :

BK = black



BN = brown

BU = blue

GY = grey

WH = white

### Diagrams and graphs

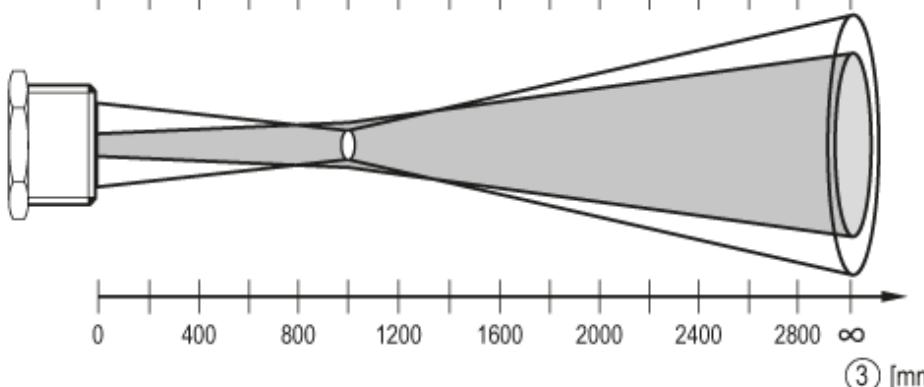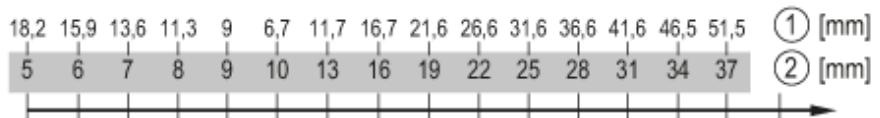

1 diameter of the measured spot

2 Diameter LED pilot light

3 measuring distance